


석면해체 · 제거 사업장의 석면비산 측정 위치 및 결과

측정 결과				
측정 일시	2018.09.05			
측정 결과	시료번호	측정 지점	측정 결과(f/cc)	검출 석면
	TP1-01	부지경계선(남동)	0.0013	기준치미만(0.01f/cc)
	TP1-02	부지경계선(남서)	0.0005	기준치미만(0.01f/cc)
	TP1-03	부지경계선(북서)	0.0006	기준치미만(0.01f/cc)
	TP1-04	부지경계선(북동)	0.0004	기준치미만(0.01f/cc)
	TP1-05	위생설비 입구	0.0081	기준치미만(0.01f/cc)
	TP1-06	음압기 통과 공기 배출구	0.0034	기준치미만(0.01f/cc)
	TP1-07	거주자 주거지역1	0.0014	기준치미만(0.01f/cc)
	TP1-08	거주자 주거지역2	0.0022	기준치미만(0.01f/cc)
	TP1-09	폐기물 반출구	0.0058	기준치미만(0.01f/cc)
	TP1-10	폐기물 보관지점1	0.0028	기준치미만(0.01f/cc)
	TP1-11	폐기물 보관지점2	0.0030	기준치미만(0.01f/cc)

측정 지점 위치(도식도)

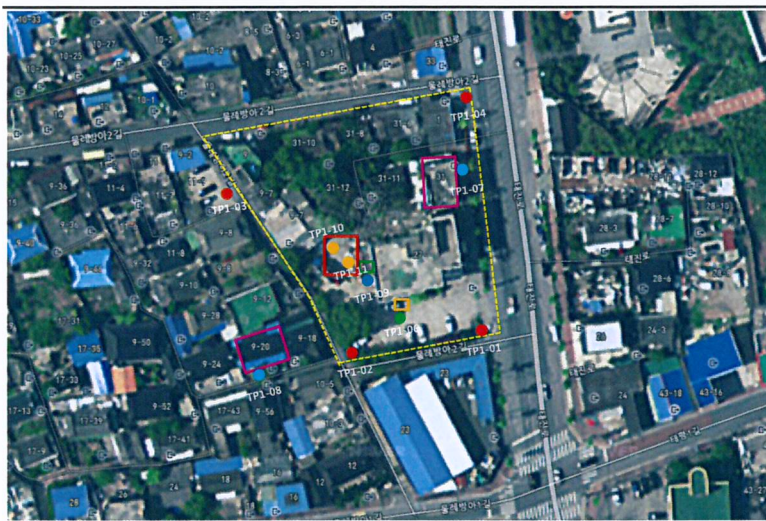

범례



부지경계선



음압기



거주자 주거지역



폐기물 반출구



폐기물 보관장소



위생설비



부지경계선 측정지점



음압기 통과 공기
배출구 측정지점



거주자 주거지역
측정지점



폐기물 반출구 측정지점



폐기물 보관장소
측정지점



위생설비 측정지점

첨부서류

「산업안전보건법 시행규칙」 별지 제17호의6서식의 석면해체 · 제거작업 신고서 사본

수수료
없음

210mm × 297mm [백상지 80g/㎡ (재활용품)]